

Fashion Manor

Description: Fashion Manor has a hot mix asphalt surface with good drainage.

Township: Perry
Rating: 7 – Good
Length: 0.58 miles
Width: 20 feet
Area: 6,805 SYS

Pavement: Fashion Manor is a chip and seal subdivision on a solid base, only routine maintenance is programmed at this time.

Pavement cost: \$0.00

Drainage: The drainage system requires of some culvert replacement, ditch cleaning, and jet/vac work. Full scope of drainage improvements are attached.

Drainage cost: \$7,476.00

Total Cost +10% Contingency: \$8,223.60



Ariel



Street view 1 - 2-2-16



Street view 2 - 2-2-16

Frick's Addition

Description: Frick's Addition is a hot mix asphalt construction that is in good condition.

Township: Sparta

Rating: 7 – Good

Length: 0.34 miles

Width: 25 feet

Area: 4,987 SYS

Pavement: This pavement was cracksealed in 2015, additional crackseal is scheduled for 2020.

Pavement cost: \$2,010.00

Drainage: The drainage system is in good condition and only routine maintenance is required at this time.

Drainage cost: \$0.00

Total cost: \$2,210.00



Ariel



Street view 1- 2-4-16



Street view 2- 2-4-16

Cobblestone

Description: Cobblestone subdivision is built with curb and gutter drainage. The pavement is hot mix asphalt construction that is in good condition. The drainage and roadway surface are both in good condition and only require routine maintenance at this time.

Township: Orange

Rating: 7 – Good

Length: 1.35 miles

Width: 24 feet

Area: 19,000 SYS

Pavement: This pavement was crack sealed in 2015 and is in good condition. A single microseal is programmed for 2021.

Pavement cost: \$46,000.00

Drainage: With the curb and gutter drainage in good condition only routine maintenance is required.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$50,625.00



Ariel



Street view 1 - 2-17-16



Street View 2 - 2-17-16

Wood Way

Description: Wood Way is concrete construction with a curb and gutter drainage system.

Township: Sparta

Rating: 7 – Good

Length: 0.2 miles

Width: 27 feet

Area: 19,000 SYS


Pavement: The concrete surface is in good condition and was crack sealed in 2015. Only routine maintenance is required at this time.

Pavement cost: \$0.00

Drainage: The curb and gutter is in good condition and only routine maintenance is required at this time.

Drainage cost: \$0.00

Total cost: \$0.00

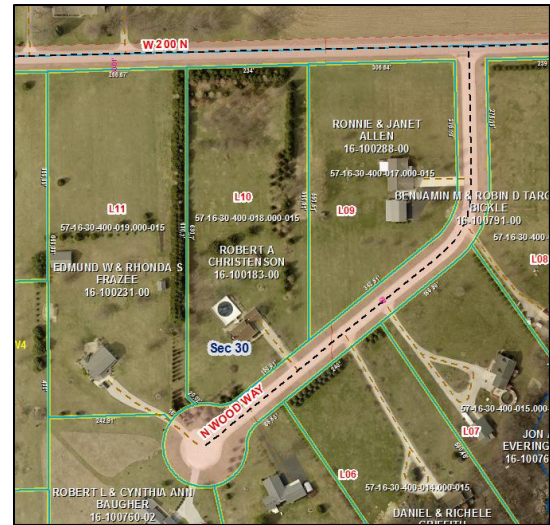

Ariel



Street view 1 - 2-3-16




Street view 2 – 2-4-16

County Road 15 West

Description: CR 15 West has a chip and seal surface. This roadway is currently in good condition and requires only routine maintenance.

Township: Elkhart
Rating: 6 – Good
Length: 0.72 miles
Width: 20 feet
Area: 8,448 SYS

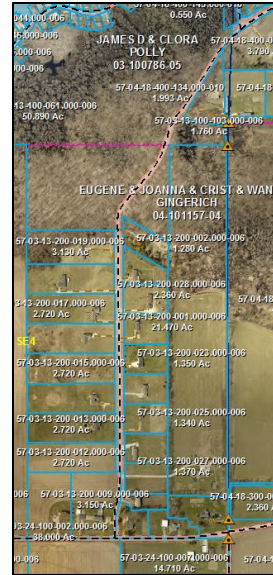

Ariel

Pavement: This pavement was chip and sealed in 2015 and is in good condition. Only routine maintenance is required at this time.

Pavement Cost: \$0.00

Drainage: The berm was pulled in 2015 and is in good condition. Only routine maintenance is required at this time.

Drainage cost: \$0.00

Total cost: \$0.00



15 West 1 - 2-4-16




15 West 2 - 2-4-16

Sunset Shores

Description: Sunset Shores is a chip and seal addition located off CR 50 South. It was chip and sealed in 2015 and is in good condition.

Township: Noble
Rating: 6 – Good
Length: 0.33 miles
Width: 20 feet
Area: 3,872 SYS

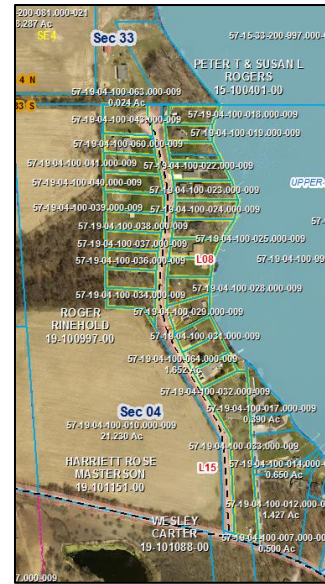

Ariel

Pavement: In 2015 a single chip and seal was applied. A double micro seal is programmed for 2021.

Pavement cost: \$16,500.00

Drainage: Minor culvert and ditch work is required.

Drainage cost: \$2,068.00

Total cost +10% Contingency: \$20,424.80



Street view 1 - 2-19-16



Street view 2 - 2-19-16

High Lake

Description: High Lake is a lake subdivision was constructed with hot mix asphalt and was chip and sealed in 2015.

Township: Noble
Rating: 7 – Good
Length: 1.1 miles
Width: 20 feet
Area: 12,906 SYS

Pavement: High Lake is in good condition and is scheduled for a microsurface in 2021.

Pavement cost: \$41,250.00

Drainage: Several driveway culverts and crossing culverts need replaced. Full scope of drainage improvements are attached.

Drainage cost: \$9,554.00

Total cost +10% Contingency: \$50,800.00



Ariel



Street view 1 - 2-19-16



Street view 2 - 2-19-16

Red Bud Lane

Description: Red Bud Lane was constructed with hot mix asphalt construction and received a chip and seal overlay in 2015.

Township: Noble
Rating: 7 – Good
Length: 0.35 miles
Width: 20 feet
Area: 4,106 SYS

Pavement: This pavement was chip and sealed in 2015 and is programmed for a single microseal in 2021.

Pavement cost: \$13,125.00

Drainage: The drainage is in good condition with some minor work required to be done. Full scope of drainage improvements are attached.

Drainage cost: \$261.00

Total cost +10% Contingency: \$14,725.00



Ariel



Street view 1 - 2-19-16



Street view 2 - 2-19-16

Southwood Shores

Description: Southwood Shores was constructed with hot mix asphalt and is currently in very good condition.

Township: Noble
Rating: 7 - Good
Length: 0.43 miles
Width: 22 feet
Area: 5,549 SYS


Pavement: The asphalt roadway was crack sealed in 2015 as a preservation treatment. Only routine maintenance is required.

Pavement cost: \$0.00

Drainage: The drainage system is in very good condition and only routine maintenance is programmed.

Drainage cost: \$0.00

Total cost: \$0.00

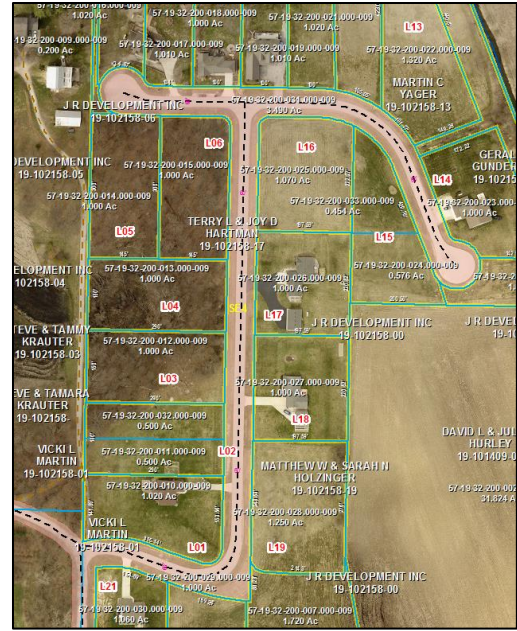

Ariel



Street view 1 - 2-4-16



Street view 2 - 2-4-16

Oak Shore

Description: Oak shore consists of a chip and seal surface that is in good condition.

Township: Orange
Rating: 7 – Good
Length: 1.74 miles
Width: 20 feet
Area: 20,416 SYS

Pavement: The subdivision most recently received a double chip and seal treatment in 2015. It is programmed for a single microseal in 2021.

Pavement cost: \$65,250.00

Drainage: There are several crossing culverts and driveway culverts in need of replacement. Full scope of drainage improvements are attached.

Drainage cost: \$11,784.00

Total cost +10% Contingency: \$84,750.00



Ariel



Street view 1- 2-2-16



Street view 2 - 2-2-16

Steinbarger Lake

Description: Steinbarger Lake has a hot mix asphalt base, with a chip and seal overlay.

Township: Orange
Rating: 7 – Good
Length: 1.1 miles
Width: 18 feet
Area: 11,616 SYS


Pavement: Steinbarger Lake received a single chip and seal in 2015. The surface is in very good condition and should only require routine maintenance for now.

Pavement cost: \$0.00

Drainage: The drainage at Steinbarger Lake requires major improvements. There are several driveway culverts and crossing culverts that require to be replaced. Full scope of drainage improvements are attached.

Drainage cost: \$28,230.00

Total cost +10% Contingency: \$31,053.00

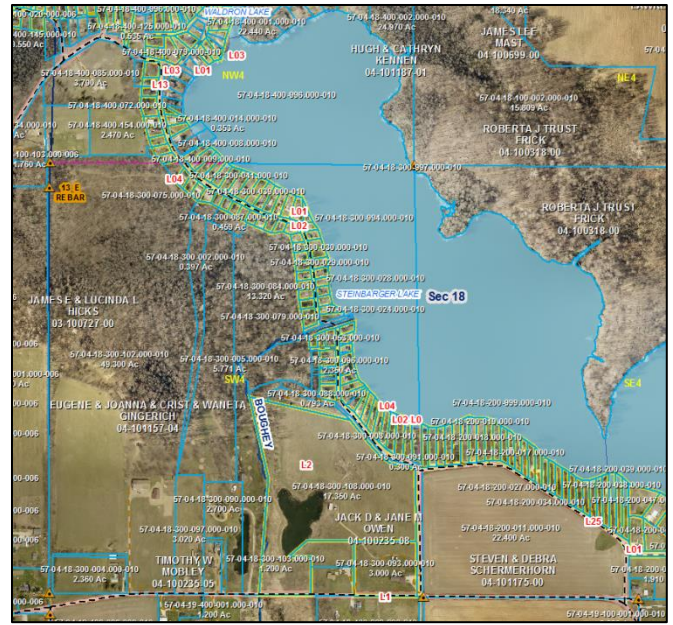

Ariel



Street view 1 - 2-23-16



Street view 2 - 2-23-16

Brimfield

Description: Brimfield was constructed with hot mix asphalt and has most recently been overlaid in 2019.

Township: Orange
Rating: 9 – Excellent
Length: 2.33 miles
Width: 20 feet
Area: 27,338 SYS

Pavement: This pavement is in excellent condition and only requires routine maintenance.

Pavement cost: \$0.00


Drainage: Significant drainage improvements were made prior to the 2019 overlay. The drainage is in good condition and only requires routine maintenance.

Drainage cost: \$0.00


Total cost +10% Contingency: \$0.00



Ariel

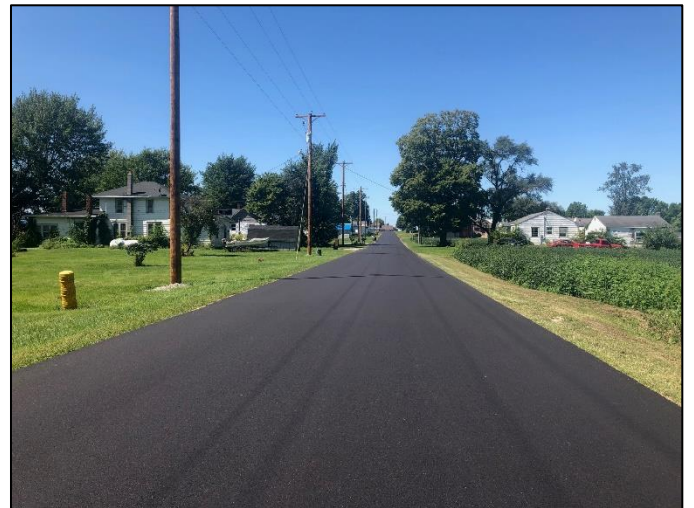

Street view 1 - 8-29-19

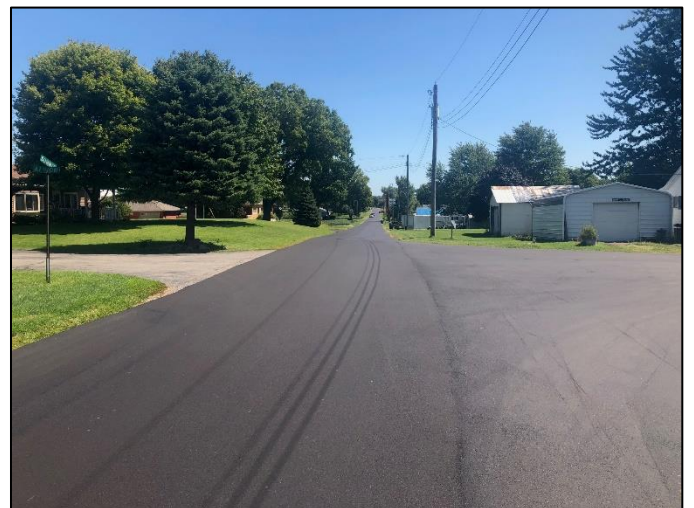

Street view 2 - 8-29-19

Skinner Lake

Description: Skinner Lake subdivision was constructed with hot mix asphalt and is in good condition. Minor ditch and berm work is required to maintain this proper drainage.

Township: Jefferson
Rating: 6 – Good
Length: 1.56 miles
Width: 20 feet
Area: 18,304 SYS

Pavement: The asphalt base is in good condition and was crack sealed in 2015. A single microsurface is scheduled for 2021.

Pavement cost: \$58,500.00

Drainage: Some driveway culverts and crossing culverts require replacement. Full scope of drainage improvements are attached.

Drainage cost: \$25,220.00

Total cost +10% Contingency: \$91,100.00



Ariel



Street view 1 - 1-16-16



Street view 2 - 1-16-16

Brookside Estates

Description: Brookside Estates is a concrete roadway with curb and gutter drainage. The surface is deteriorating and will require some patching and replacement in the most severe areas.

Township: Wayne
Rating: 5 – Fair
Length: 1.74 miles
Width: 26 feet
Area: 26,540 SYS


Pavement: Some issues are arising due to improper subbase preparation. We will continue to monitor distressed areas and patch. Concrete repairs are scheduled for 2021.

Pavement cost: \$83,000

Drainage: With the curb and gutter drainage in good condition only routine maintenance is required at this time. Underground springs may need addressed.

Drainage cost: \$0.00

Total cost +10% Contingency: \$91,000

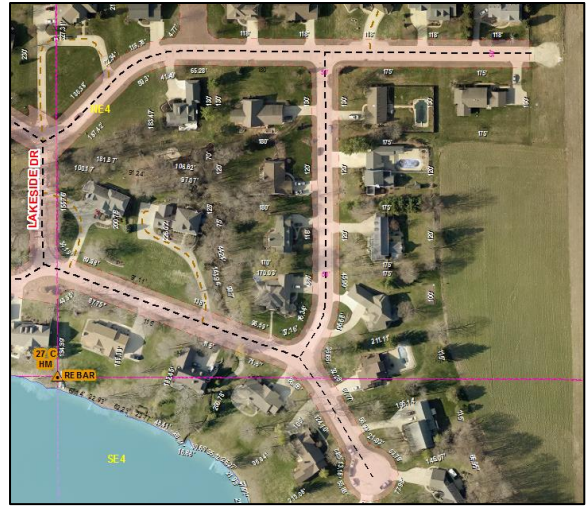

Ariel



Street view 1 - 2-23-16



Street view 2 - 2-23-16

Noble Hawk

Description: Noble Hawk is a hot mix asphalt roadway that was double microsealed in 2016.

Township: Allen
Rating: 7 – Good
Length: 1.12 miles
Width: 22 feet
Area: 14,455 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost +10% Contingency: \$0.00



Ariel



Street view - 8-15-17



Street view 2 - 8-15-17

Town of LaOtto

Description: The Town of LaOtto consists of hot mix asphalt roadways that are in good condition.

Township: Swan
Rating: 6-7 – Good
Length: 1.74 miles
Width: 20 feet
Area: 20,416 SYS

Pavement: The roadways received an asphalt rejuvenator in 2016 and were crack sealed in 2017. The roadway is in good condition and only requires routine maintenance.

Pavement cost: \$0.00

Drainage: Minor Drainage improvements were completed in 2016 prior to the rejuvenator. The drainage is in good and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% contingency: \$0.00



Ariel



Street view 1 - 2-18-16



Street view 2 - 2-18-16

Country Home Estates

Description: Country Home Estates is a chip and seal addition that was microsealed in 2016 and is in good condition.

Township: Perry
Rating: 7 – Good
Length: 0.25 miles
Width: 22 feet
Area: 3,226 SYS


Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

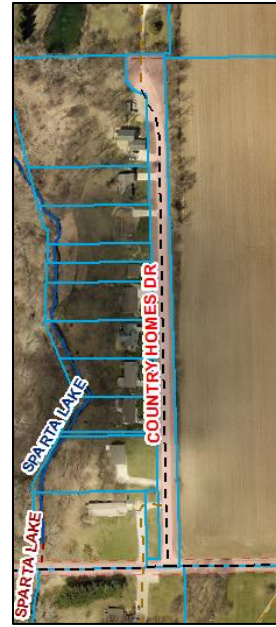

Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Shorewood Oaks “Circle Drive”

Description: Circle Drive is a chip and seal addition that was microsealed in 2017 and is in good condition.

Township: Sparta
Rating: 7 – Good
Length: 0.37 miles
Width: 20 feet
Area: 4,341 SYS


Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

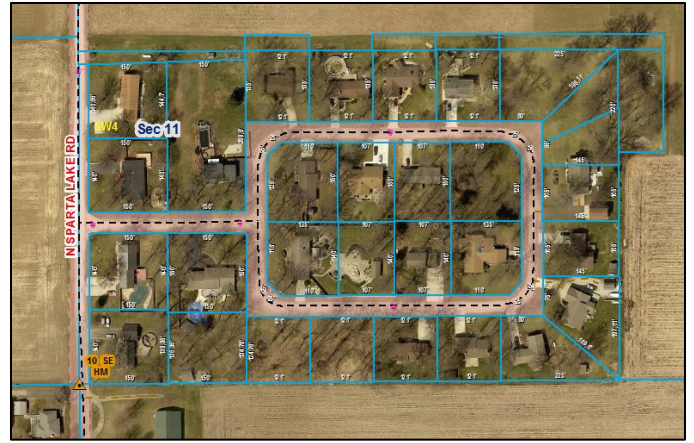

Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Knapp Lake Northside

Description: The Northside of Knapp Lake has a chip and seal surface that received 2" HMA overlay in 2017 and is in very good condition.

Township: Washington

Rating: 7 – Good

Length: 1.23 miles

Width: 20 feet

Area: 14,432 SYS


Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

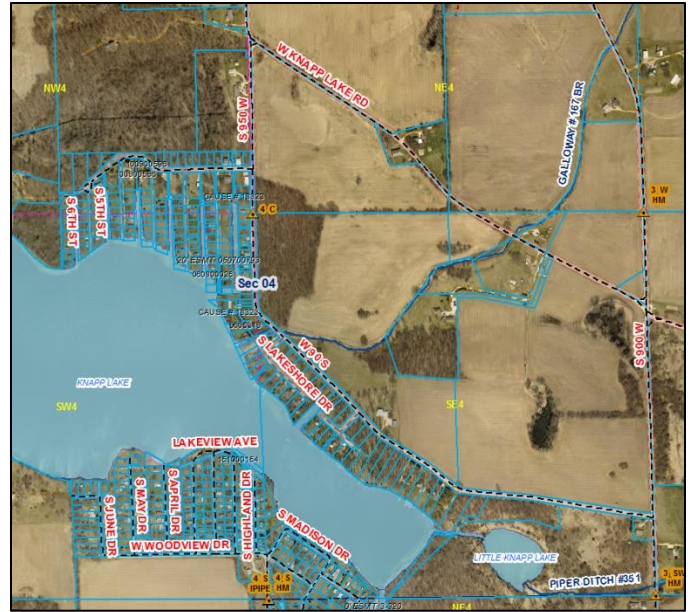

Ariel



Street view 1 - 10-10-17



Street view 2 - 10-10-17

Smalley Lake

Description: Smalley Lake Subdivision was constructed with cold mix and received a single chip and seal in 2014.

Township: Washington

Rating: 5 – Fair

Length: 0.57 miles

Width: 15 feet

Area: 5,077 SYS

Pavement: The subdivision is scheduled for a single microseal in 2021.

Pavement cost: \$21,375.00

Drainage: The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost +10% Contingency: \$23,500.00



Ariel



Street view 1 - 2-23-16



Street view 2 - 2-23-16

Eagle Island

Description: Eagle Island is a chip and seal roadway that received a HMA overlay in 2018.

Township: Elkhart
Rating: 8 – Very Good
Length: 0.78 miles
Width: 18 feet
Area: 8,236 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2018 prior to the overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 – 5-15-19



Street view 2 – 5-15-19

Cosperville

Description: Cosperville subdivision consists of a chip and seal roadway that received a double microseal in 2016.

Township: Elkhart

Rating: 7 – Good

Length: 0.38 miles

Width: 20 feet

Area: 4,458

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Wawaka

Description: Wawaka contains a combination of chip and seal and hot mix asphalt roadways. The chip and seal roadways received a HMA overlay in 2019.

Township: Elkhart
Rating: 5 / 9 – Fair / Excellent
Length: 1.91 miles
Width: 20 feet
Area: 22,410 SYS

Pavement: The roadways that were not overlaid are scheduled for a single microseal in 2021.

Pavement cost: \$34,750.00

Drainage: Drainage improvements were completed in 2019 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost +10% Contingency: \$38,250.00



Ariel



Street view 1 – 9-11-19



Street view 2 - 1-16-16

Pheasant Cove

Description: Pheasant Cove is a chip and seal addition that was chip and sealed in 2014.

Township: York
Rating: 6 – Good
Length: 2.86 miles
Width: 20 feet
Area: 33,557

Pavement: The pavement is in fair condition and is scheduled for a double microseal in 2021.

Pavement cost: \$143,000.00

Drainage: The subdivision will require extensive ditch and berm work, along with the replacement of several driveway and crossing culverts. Full scope of drainage improvements are attached.

Drainage cost: \$26,156.00

Total cost +10% Contingency: \$186,000



Ariel



Street view 1 - 2-23-16



Street view 2 - 2-23-16

Finlandia

Description: Finlandia consists of hot mix asphalt roadways that were microsealed in 2016.

Township: York
Rating: 7 – Good
Length: 0.77 miles
Width: 20 feet
Area: 9,034 SYS

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Oakwood Drive “25 North”

Description: Oakwood Drive is a chip and seal roadway that was microsealed in 2017.

Township: York
Rating: 5 – Fair
Length: 0.67 miles
Width: 20 feet
Area: 7,861 SYS



Ariel

Pavement: The roadway is in fair condition, but will require improvements in the future.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Street view 1 - 4-1-16



Street view 2 - 4-1-16

Port Mitchell

Description: Port Mitchell consists of hot mix asphalt roadways that were paved in 2017.

Township: York
Rating: 7 – Very Good
Length: 0.61 miles
Width: 16 feet
Area: 5,725 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 9-28-17



Street view 2 - 9-28-17

Town of Wolf Lake

Description: The Town of Wolf Lake consists of asphalt roadways that received a HMA overlay in 2019.

Township: Noble
Rating: 9 – Excellent
Length: 1.44 miles
Width: 20 feet
Area: 16,896 SYS


Pavement: The roadway is in excellent condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2019 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

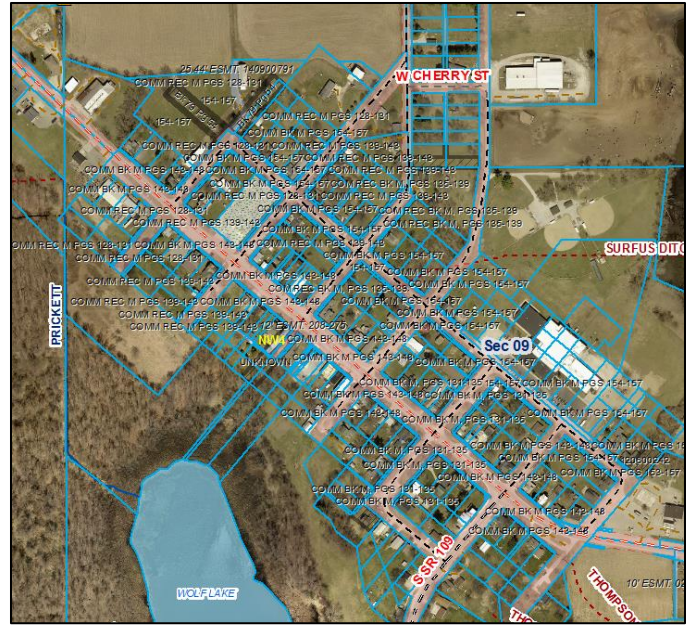

Ariel



Street view 1 - 5-15-19s



Street view 2 – 5-15-19

Williams Lake

Description: Williams Lake consists of a chip and seal roadway that received a double microseal in 2016.

Township: Noble
Rating: 7 – Good
Length: 0.42 miles
Width: 20 feet
Area: 4,928 SYS

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Muncie Lake

Description: Muncie Lake consists of a chip and seal roadway that received a double microseal in 2016.

Township: Noble
Rating: 7 – Good
Length: 0.68 miles
Width: 20 feet
Area: 7,978 SYS

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Silver Lake

Description: Silver Lake consists of hot mix asphalt roadways that were paved in 2017.

Township: Noble
Rating: 7 – Good
Length: 0.64 miles
Width: 18 feet
Area: 7,180 SYS

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 9-28-17



Street view 2 - 9-28-17

Crooked Lake

Description: Crooked Lake consists of hot mix asphalt roadways that were paved in 2018.

Township: Noble
Rating: 8 – Very Good
Length: 1.13 miles
Width: 18 feet
Area: 11,932


Pavement: The roadways are in very good condition and require only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2018 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

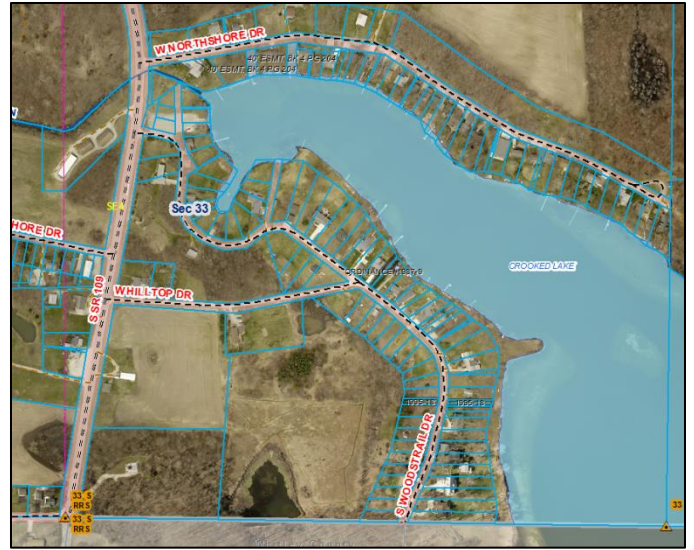

Ariel



Street view 1 - 5-15-19



Street view 2 - 5-15-19

Oak Knoll

Description: Oak Knoll has a chip and seal surface roadway that is in good condition.

Township: Orange
Rating: 7 – Good
Length: 0.63 miles
Width: 20 feet
Area: 7,394 SYS

Pavement: Oak Knoll received a double chip and seal in 2015 and is scheduled for a microseal in 2021.

Pavement cost: \$23,625

Drainage: Requires minor drainage improvements. Some driveway and crossing culverts need replacement along with minor ditch and berm work. Full scope of drainage improvements are attached.

Drainage cost: \$2,960.00

Total cost +10% Contingency: \$29,250



Ariel



Street view 1 - 2-2-16




Street view 2 - 2-2-16

Jones Lake

Description: Jones Lake consists of hot mix asphalt roadways that were paved in 2017.

Township: Orange
Rating: 8 – Very Good
Length: 0.41 miles
Width: 19 feet
Area: 4,570 SYS

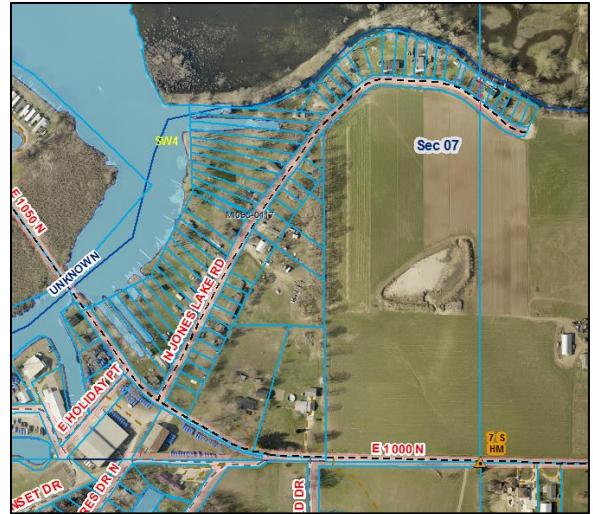

Ariel

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00


Drainage: Drainage improvements were completed in 2017 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Street view 1 – 9-25-17

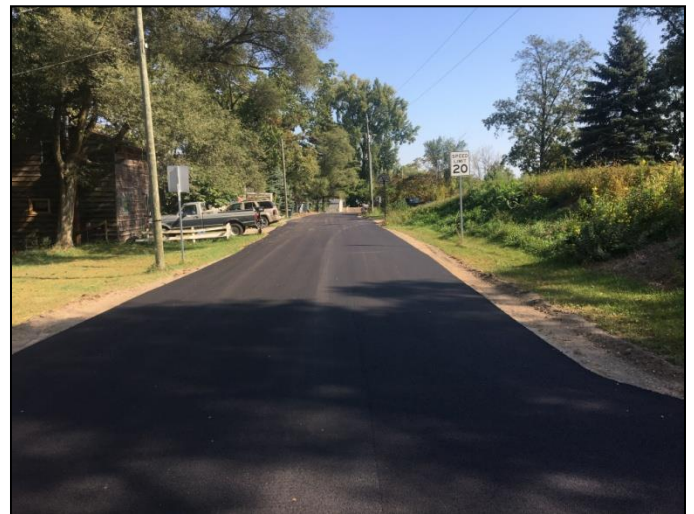

Street view 2 – 9-25-17

Cree Lake

Description: The roadways at Cree Lake were originally constructed with chip and seal. In 2017, the south side was double microsealed and the north side received a 2" HMA overlay.

Township: Wayne
Rating: 7-8, Good - Very Good
Length: 1.56 miles
Width: 20 feet
Area: 18,304 SYS

Pavement: The roadways are in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the road improvements. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 northside - 10-3-17



Street view southside - 8-23-17



Street view 3 northside - 10-5-17

Schockopee Lake

Description: Schockopee Lake consists of a hot mix asphalt roadway that received a double microseal in 2016.

Township: Wayne
Rating: 7 – Good
Length: 0.57 miles
Width: 20 feet
Area: 6,688 SYS


Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

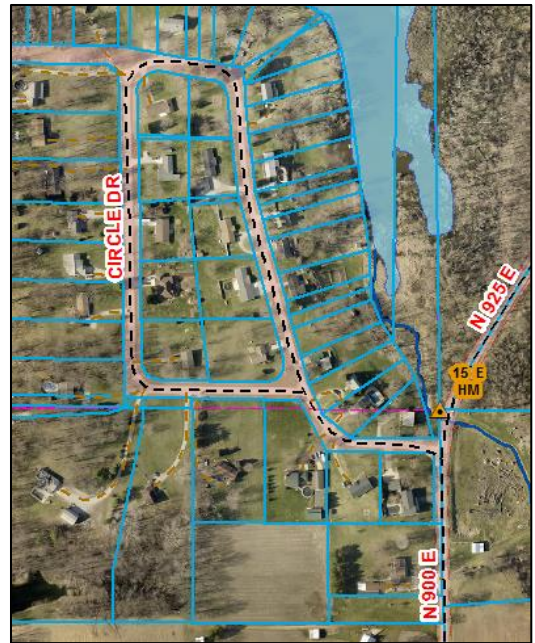

Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Buena Vista

Description: Buena Vista received an HMA overlay in 2018 and is in a very good condition.

Township: Wayne
Rating: 8 – Very Good
Length: 0.44 miles
Width: 20 feet
Area: 5,162 SYS

Pavement: This pavement is in very good condition and only requires routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were made prior to the 2018 overlay. The drainage is in good condition and only requires routine maintenance.

Drainage cost: \$0.00

Total cost +10% Contingency: \$0.00



Ariel



Street view 1 – 5-15-19



Street view 2 - 5-15-19

Terrance Hills

Description: Terrance Hills consists of a chip and seal roadway that received a double microseal in 2016.

Township: Wayne
Rating: 7 – Good
Length: 0.57 miles
Width: 20 feet
Area: 6,688 SYS


Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

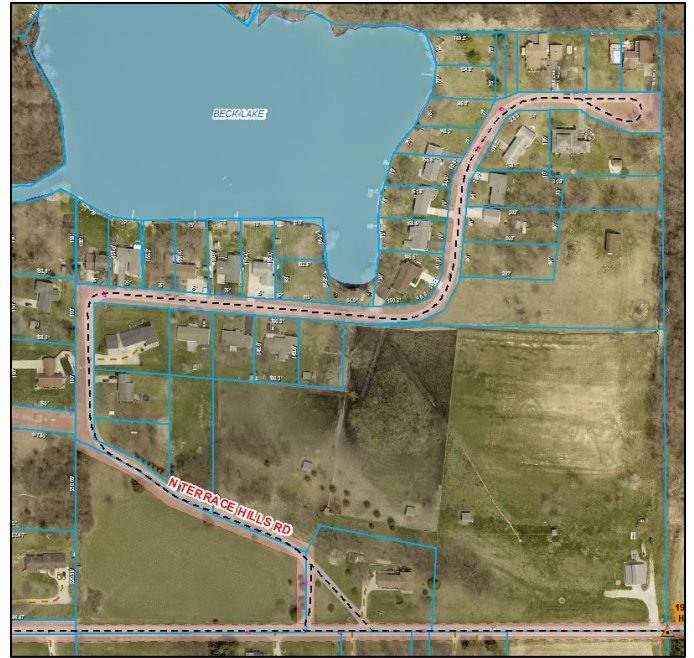

Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Northshore Drive

Description: Northshore Drive consists of hot mix asphalt roadways that were paved in 2017.

Township: Wayne
Rating: 8 – Very Good
Length: 1.48 miles
Width: 20 feet
Area: 17,365 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 10-9-17



Street view 2 – 10-10-17

Sunset Shores

Description: Sunset Shores consists of hot mix asphalt roadways that were paved in 2017.

Township: Wayne
Rating: 8 – Very Good
Length: 0.98 miles
Width: 20 feet
Area: 11,498 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 10/12/17



Street view 2 - 10-12-17

Wakefield Village

Description: Wakefield Village consists of a chip and seal roadway that received a double microseal in 2017.

Township: Wayne
Rating: 7 – Good
Length: 2.02 miles
Width: 20 feet
Area: 23,701 SYS


Pavement: The roadway is in good condition, but will require improvements in the future. It is scheduled for a HMA overlay in 2022.

Pavement cost: \$156,000.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$171,600

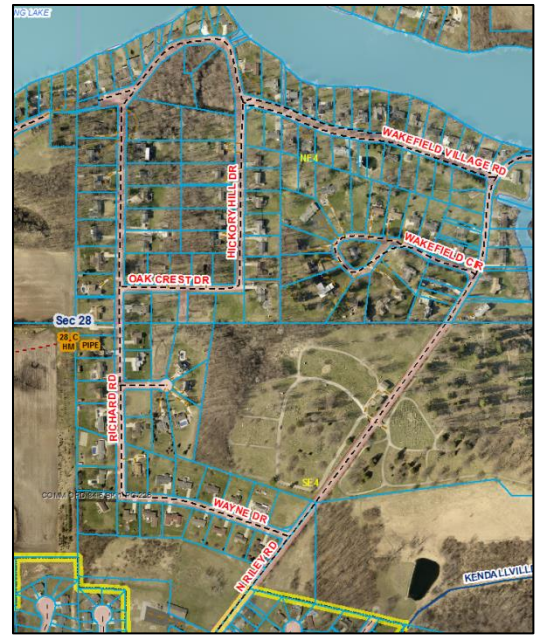

Ariel



Street view 1 - 8-15-17



Street view 2 – 8-15-17

Baby Mountain

Description: Baby Mountain consists of hot mix asphalt roadways that received a double microseal in 2017.

Township: Wayne
Rating: 7 – Good
Length: 0.84 miles
Width: 20 feet
Area: 9,856 SYS

Pavement: The roadways are in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Meadow Lanes

Description: Meadow Lanes East consists of hot mix asphalt that were overlaid in 2018 and in very good condition. Meadow Lanes West consists of hot mix asphalt that is in good condition.

Township: Wayne

Rating: 6-7 – Good / Very Good

Length: 1.4 miles

Width: 22 feet

Area: 18,069

Pavement: The roadways are in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2018 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 westside - 2-17-16



Street view 2 eastside – 5-18-20



Street view 3 eastside - 5-18-20

Bodenhafer

Description: Bodenhafer addition consists of chip and seal roadways that received a double microseal in 2017.

Township: Allen
Rating: 7 – Good
Length: 0.43 miles
Width: 20 feet
Area: 5,042 SYS


Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00


Total cost + 10% Contingency: \$0.00

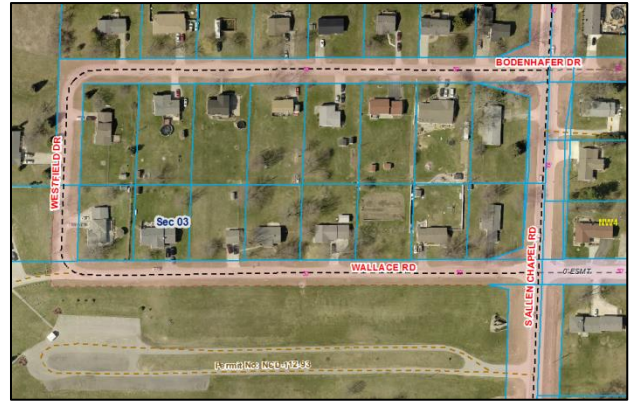

Ariel



Street view 1 - 8-15-17

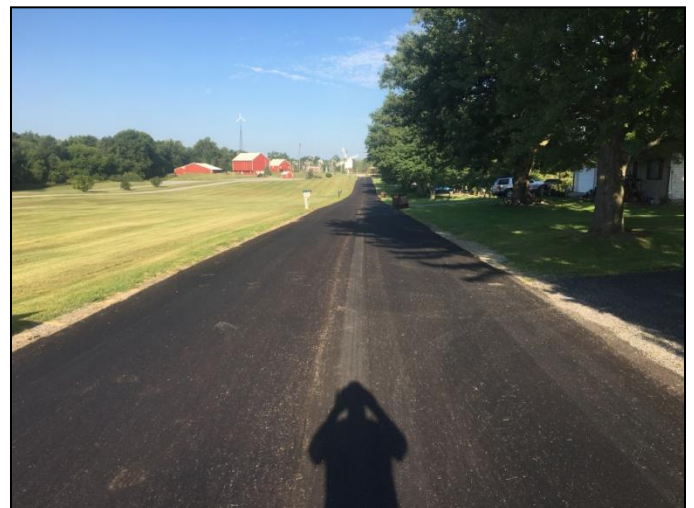

Street view 2 - 8-15-17

Greenwood Drive

Description: Greenwood Drive consists of a chip and seal roadway that received a double microseal in 2017.

Township: Allen
Rating: 8 – Good
Length: 0.48 miles
Width: 20 feet
Area: 5,632 SYS

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

Arthur Drive

Description: Arthur Drive has hot mix asphalt roadways that are in good condition.

Township: Jefferson
Rating: 6 – Good
Length: 0.44 miles
Width: 20 feet
Area: 5,162 SYS

Pavement: This pavement was crack sealed in 2015 and is scheduled for a microseal in 2021.

Pavement cost: \$16,500.00

Drainage: The drainage is good condition, needing only a few driveway and crossing culverts replaced. Full scope of drainage improvements are attached.

Drainage cost: \$2,395.00

Total cost +10% Contingency: \$20,750.00



Ariel



Street view 1 - 2-29-16



Street view 2 - 2-29-16

Highpoint Drive

Description: Highpoint Drive consists of hot mix asphalt roadways that are in good condition.

Township: Noble
Rating: 7 – Good
Length: 0.61 miles
Width: 20 feet
Area: 7,157 SYS

Pavement: This asphalt base was chip and sealed in 2014 and is scheduled for microseal in 2021.

Pavement cost: \$22,875.00

Drainage: Minor ditch and berm work is required. Some of the driveway and crossing culverts need replaced, along with some drainage tile. Full scope of drainage improvements are attached.

Drainage cost: \$12,198.00

Total cost +10% Contingency: \$38,580.00



Ariel



Street view 1 - 2-19-16



Street view 2 - 2-19-16

Lakeshore Drive

Description: Lakeshore Drive consists of an HMA base that received a chip and seal overlay in 2014.

Township: Noble
Rating: 7 – Good
Length: 0.97 miles
Width: 20 feet
Area: 10,812 SYS

Pavement: The roadway is in good condition and is scheduled for a microseal in 2021.

Pavement cost: \$36,375.00


Drainage: The drainage is in fair condition, but will require some driveway and crossing culverts to be replaced. Full scope of drainage improvements are attached.

Drainage cost: \$7,580.00

Total cost +10% Contingency: \$48,350.00



Ariel

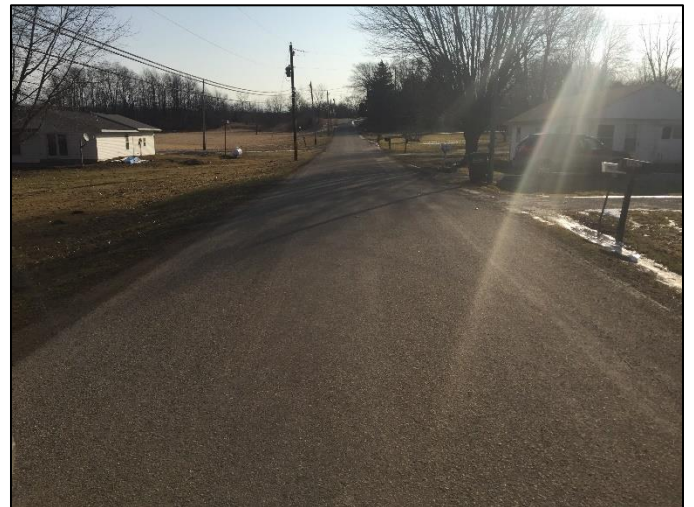

Street view 1 - 2-19-16



Street view 2 - 2-19-16

Bear Lake

Description: Bear Lake received a major HMA structural overlay in 2019 and is an excellent condition.

Township: Noble
Rating: 9 – Excellent
Length: 2.8 miles
Width: 18 feet
Area: 29,568 SYS



Ariel

Pavement: This pavement is in excellent condition and only requires routine maintenance.

Pavement cost: \$0.00

Drainage: Significant drainage improvements were made prior to the 2019 overlay. The drainage is in good condition and only requires routine maintenance.

Drainage cost: \$0.00

Total cost +10% Contingency: \$0.00



Street view 1 - 6-12-19



Street view 2 - 6-12-19

Hunters Cove

Description: Hunters Cove consists of hot mix asphalt roadways with curb and gutter drainage. This addition is in good condition.

Township: Swan
Rating: 7 – Good
Length: 0.19 miles
Width: 22 feet
Area: 2,563 SYS

Pavement: This asphalt pavement is in good condition and was crack sealed in 2016 and is scheduled for a microseal in 2021.

Pavement cost: \$7,125.00

Drainage: The curb and gutter are in good condition and only require routine maintenance.

Drainage cost: \$0.00

Total cost +10% Contingency: \$7,850.00



Ariel



Street view 1 - 2-18-16



Street view 2 - 2-18-16

Meadow Court

Description: Meadow Court consists of hot mix asphalt roadways that received a microseal in 2016.

Township: York
Rating: 8 – Good
Length: 0.06 miles
Width: 22 feet
Area: 774 SYS

Pavement: The roadway is in good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 – 8-15-17



Street view 2 – 8-15-17

East Engle Lake

Description: East Engle Lake consists of hot mix asphalt roadways were paved in 2017.

Township: Sparta
Rating: 8 – Very Good
Length: 0.32 miles
Width: 20 feet
Area: 3,754 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the HMA overlay. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 9-17-17



Street view 1 - 9-17-17

Limberlost Trail

Description: Limberlost Trail consists of chip and seal roadways that received a double microseal in 2017.

Township: Orange
Rating: 7 – Good
Length: 0.44 miles
Width: 20 feet
Area: 5,162 SYS


Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00

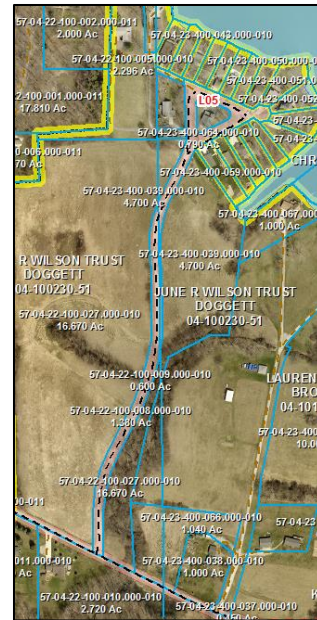

Ariel



Street view 1 - 8-15-17



Street view 2 - 8-15-17

CR 60 North

Description: CR 60 North consists of chip and seal roadways that received a double microseal in 2017.

Township: Jefferson
Rating: 7 – Good
Length: 0.3 miles
Width: 18 feet
Area: 3,168 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2017 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 - 8-15-17



Street view 2 – 8-15-17

High Lake South

Description: The south side of High Lake consists of chip and seal roadways that received a double microseal in 2016.

Township: Noble
Rating: 6 – Good
Length: 0.74 miles
Width: 20 feet
Area: 8,682 SYS

Pavement: The roadway is in very good condition and requires only routine maintenance.

Pavement cost: \$0.00

Drainage: Drainage improvements were completed in 2016 prior to the microseal. The drainage is in good condition and requires only routine maintenance.

Drainage cost: \$0.00

Total cost + 10% Contingency: \$0.00



Ariel



Street view 1 – 8-15-17



Street view 2 – 8-15-17